



SERVICE BULLETIN NZ SB127

To: Snorkel product owners, Snorkel Dealers

Attention: Service Manager

**Units affected: MHP13/35 & MHP15/44 built before S/N
NZ050708**

MANDATORY MODIFICATION

**This Bulletin is to inform you of a field modification that is required on
MHP13/35 & MHP15/44 units.**

**A Spacer must be fitted inside the LOWER CYLINDER on these
machines to limit the stroke of the cylinder.**

Installation procedure for Cylinder Spacer.

- **Park the machine on firm level ground.**
- **Remove the Lower Cylinder from the machine.**
- **Using a "C Spanner", unscrew the Gland head from the
cylinder.**

- Place the two halves of the spacer onto the cylinder shaft, apply Loctite to the thread of the spacer capscrews and tighten the capscrews to 15 Nm.
- Once the spacer is fitted tighten the gland head and re-fit the cylinder onto the machine.
- Stamp an "X" onto the cylinder body to show that the spacer has been fitted [refer fig 1].
- Operate the lower boom function and check the lower cylinder for any leaks.



Fig.1

