



SERVICE BULLETIN NZ SB129

To: Snorkel product owners, Snorkel Dealers

Attention: Service Manager

**Units affected: MHP13/35 & MHP15/44 built before S/N
NZ060201 and fitted with Robin EX17 or EX21 petrol engines**

UPGRADE

**This Bulletin is to inform you of a field modification that is required on
MHP13/35's and MHP15/44's that are fitted with Robin EX17 or
EX21 petrol engines**

**Exhaust gas is getting sucked into the air intake on the Robin engines
and is causing poor engine performance.**

**To minimise any potential exhaust gas near the air intake Snorkel
part number 12539-50 is required to be fitted between the Robin
exhaust and the exhaust pipe. A high temperature silicone sealant is
also required (such as Master #7 Gasket Maker)**

Install procedure

- 1. Detach the exhaust pipe from the engine.**
- 2. Loosen the 3 bolts holding the exhaust heat shield to the engine.**
- 3. Run a bead of silicone around the engines exhaust, around the inside diameter of 12539-50 and on the outer flange as shown in the diagram, leave to skin as per the silicones instructions.**
- 4. Reassemble the exhaust to the motor with 12539-50 located between the exhaust pipe and the engine 's exhaust heat shield.**

The small outer diameter on 12539-50 faces towards the engine and fits over the engine's exhaust tube.

